

Manhole Inspection Summary

Manhole # S07KK_015MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **07KK** Node: **015** Status: **Found**

Insp Date: **2/1/08 12:54 PM**

Incomplete Comments

Crew: **RL GH**
Inspector: **Lamont**
Firm: **URS**

Location Address: **2101 ALLENDALE RD**

Cross Street: **CLIFTON AVE**

Manhole Type: **Junction**

Location: **Grass**

Ground Conditions: **Standing Water**

☐ Prev. Rehab

Weather: **Heavy Rain**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☐ Exists Material:

☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **5** Missing: **0** ☒ **Corroded**


Surcharge

☒ **Evidence Of Surcharge** Depth: **4** (ft.) ☐ Active Surcharge Present

Location View



Top View

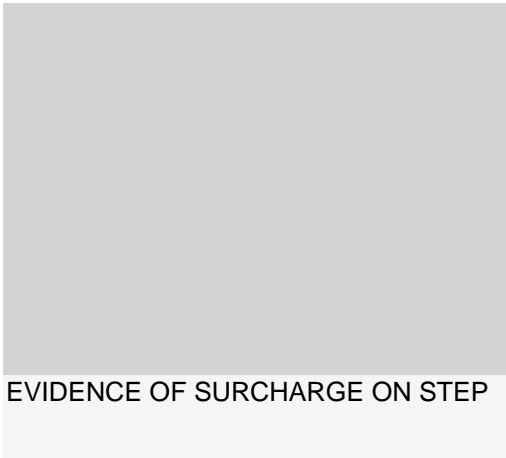

EVIDENCE OF SURCHARGE ON STEP

Manhole Inspection Summary

Manhole # S07KK_015MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☐ Debris ☐ Grease

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow

Drop In @ 3 O'Clock



CRACKED PIPE SEAL

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.00** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☒ **Sludge** ☐ Debris ☒ **Grease**

Silt Depth: **1** (in.) Deposits Extent: **Light**

Infiltration: **None** Pipe Seal Cond: **Cracked**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **9.20** (ft.)

Inv Depth: **10.20** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**


☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

Drop In @ 6 O'Clock

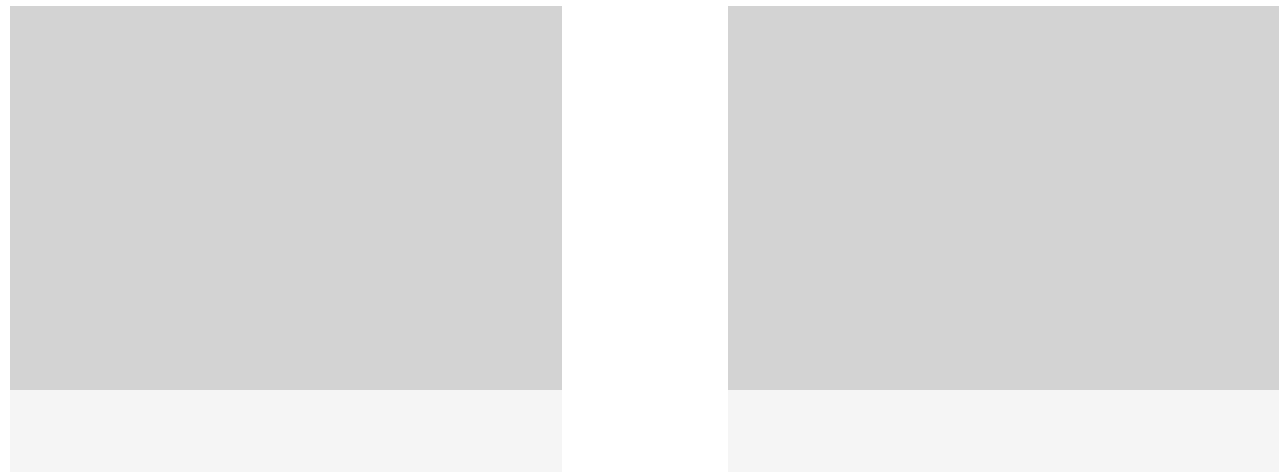

Pipe Height: 8.4 (in.) Rod and Bar (Angled)

Pipe Material: Clay

☐ Pipe Lined

Invert Depth: 7.60 (ft.) Flow Characteristics: Fast

Deposits: ☐ None ☐ Mud ☒ Sludge ☐ Debris ☐ Grease

Silt Depth: 1 (in.) Deposits Extent: Light

Infiltration: None Pipe Seal Cond: Unknown

Drop: Outside Rod and Bar

Angled: Yes Reading: 9.00 (ft.)

Inv Depth: 10.00 (ft.)

Drop Condition: Open

Connects To: Manhole

☐ Possible Illicit Connection